


Detail of 60° thread profile

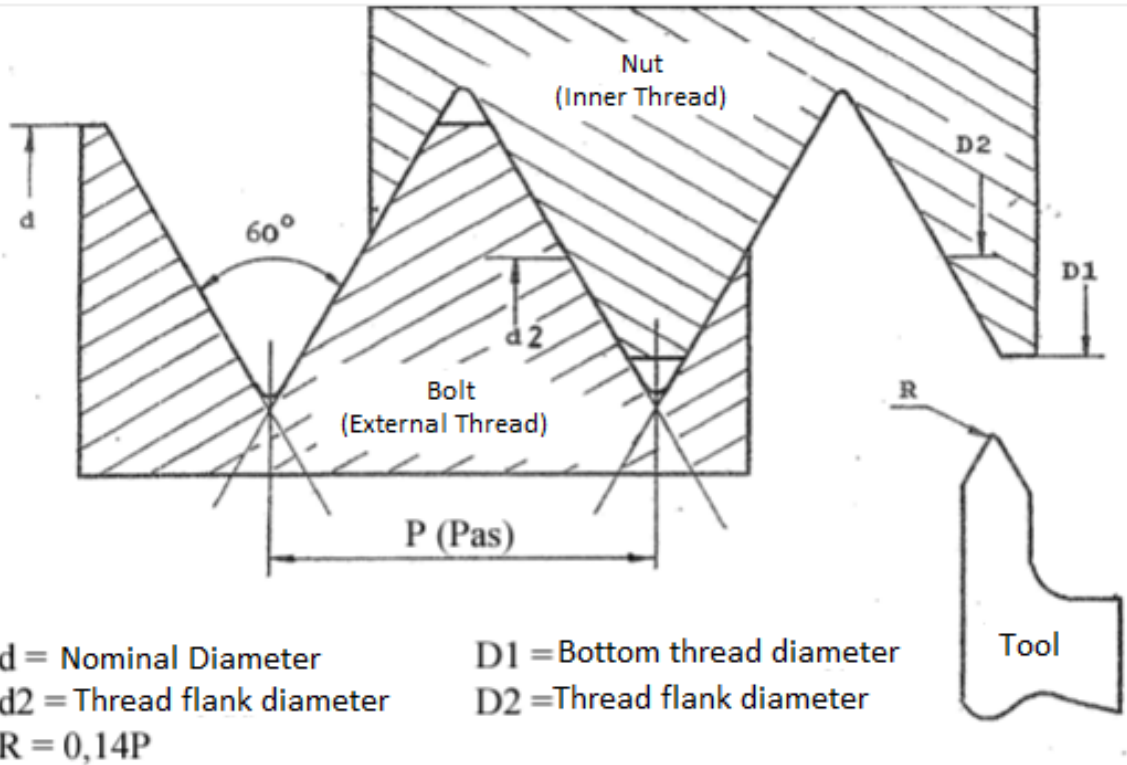

Dimensions Nominales	P	Shaft				Nut			
		D		D2		D2		D1	
		MIN	MAX	MIN	MAX	MIN	MAX	MIN	MAX
M5	0.8	4.83	4.97	4.36	4.45	4.48	4.60	4.13	4.33
M6	1.0	5.79	5.97	5.21	5.32	5.35	5.50	4.92	5.15
M8	1.25	7.76	7.97	7.04	7.16	7.19	7.34	6.65	6.91
M10	1.5	9.73	9.96	8.86	8.99	9.03	9.20	8.38	8.67
M12	1.75	11.70	11.96	10.68	10.82	10.86	11.06	10.11	10.44
M16	2.0	15.68	15.96	14.50	14.66	14.70	14.91	13.84	14.21
M18	2.5	17.62	17.95	16.16	16.33	16.38	16.60	15.29	15.74
M20	2.5	19.62	19.95	18.16	18.33	18.38	18.60	17.29	17.74
M22	2.5	21.62	21.95	20.16	20.33	20.38	20.60	19.29	19.74
M24	3.0	23.58	23.95	21.80	22.00	22.5	22.31	20.75	21.25
M30	3.5	29.52	29.94	27.46	27.67	27.73	28.00	26.21	26.77
M36	4.0	35.47	35.94	33.12	33.34	33.40	33.70	31.67	32.27
M42	4.5	41.44	41.93	38.78	39.01	39.08	39.39	37.13	37.79
M45	4.5	44.44	44.93	41.78	42.01	42.08	42.39	40.13	40.77